

## Tech Notes

---

**Title:** Battery failure initializes the controller

**Created:** 13 Apr 2012

**Last Revised:** 13 Apr 2012

---

**Applies To:** All 2100 controllers

**Problem Description:** The 2100 controller initializes during boot up and/or will not keep the parameters stored in memory

**Resolution/Work Around:** The 2100 controller 3V battery level must be above 2.8V. At 2.7V the battery does not have enough power to maintain the memory. New batteries should be around 3.3V to sustain the operation for a few years.

Battery number BR2330, Fluke item: 2135249




---

**Other Information:**